


# WYNDHAM COLLECTION



## REQUIRED TOOLS NOT IN BOX

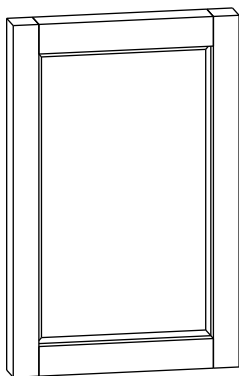


Electric drill




Tape measure



Drill bit ( $\phi 8$ )




Pencil




Screwdriver

## INSTALLATION INSTRUCTIONS


1

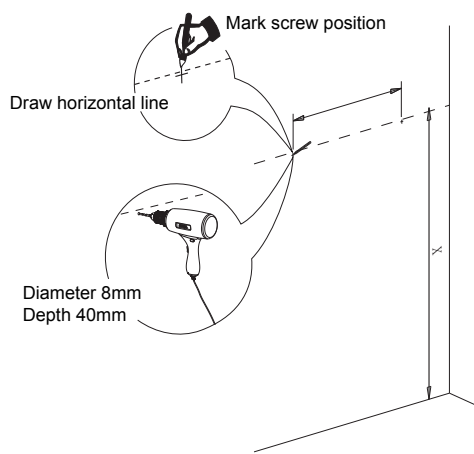

2

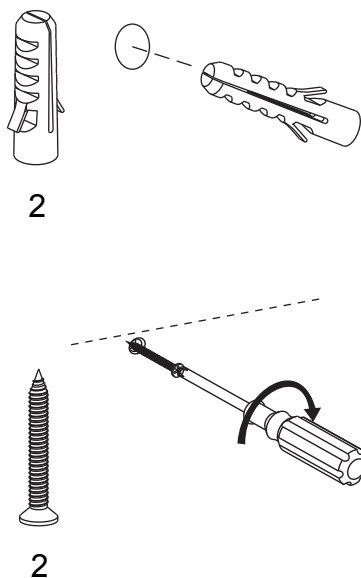

3

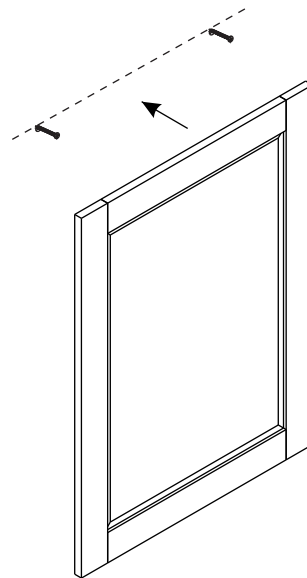

WC-R4100-MIR-24  
INSTALLATION