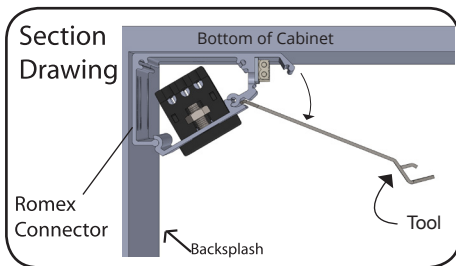# TASK lighting

Sempria® LED Lighted Power Strip
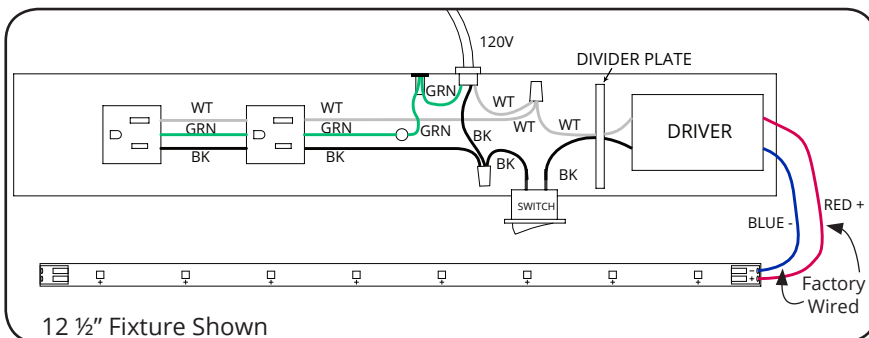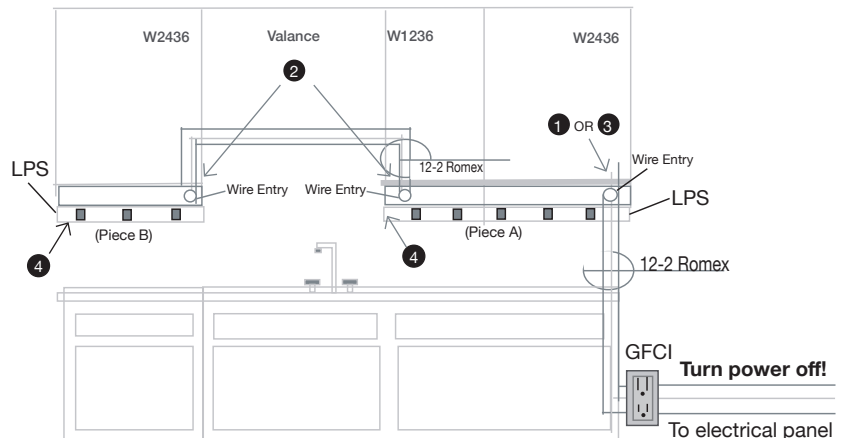## Installation Instructions **WITH Integral Driver**

General Guidelines

- Power source MUST be a 20 amp branch circuit protected by a GFCI at the panel or GFCI prior to the connection at LPS.
- All wiring must meet NEC® and local codes. The Lighted Power Strip (LPS) must be installed by a licensed electrician.
- Use knockout holes for 120V wire entrance. Use listed Romex connectors provided for 120V electrical connections.
- Use tool provided to **carefully** pry open for wiring (using other devices may damage the metal cover).
- Field cutting voids warranty.
- Light valance recommended.
- Firmly insert plug straight into receptacle, applying equal pressure to both blades at the same time. **Gently** rock plug, if needed.

Section Drawing
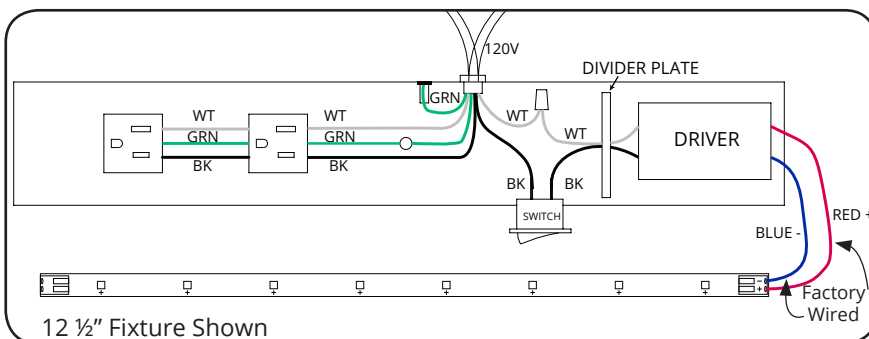
Bottom of Cabinet

Romex Connector

Tool

Backsplash

Turn power off at panel. **Carefully** pry open each piece with tool (provided). Insert Romex connector into knockout hole inside of back frame. Pull wires into LPS.

W2436   Valance   W1236   W2436

LPS

12-2 Romex

Wire Entry

Wire Entry   Wire Entry

(Piece B)   (Piece A)

LPS

12-2 Romex

GFCI   **Turn power off!**

To electrical panel

120V

DIVIDER PLATE

WT   WT
GRN   GRN   GRN
BK   BK   BK
WT   WT   WT
GRN   WT
BK   BK

DRIVER

SWITCH

RED +
BLUE -

Factory Wired

12 ½" Fixture Shown

❶ Wiring for One Circuit

Secure LPS to wall by screwing into wall studs or use anchors provided. Connect **Black** Romex wire to **Black** wire from receptacles and switch. Connect **White** Romex wire to **White** wire from receptacles and driver. Ground all **Green** wires to PEM studs inside of back frame.

❷ When connecting two LPS, run Romex from fixture to fixture. Ground each section to the next.

❸ To terminate last LPS, use wire nuts on ends of wires.

❹ Snap cover in place and turn power on.

120V

DIVIDER PLATE

WT   WT
GRN   GRN   GRN
BK   BK   WT
WT   WT
BK   BK

DRIVER

SWITCH

RED +
BLUE -

Factory Wired

12 ½" Fixture Shown

❶ Wiring for Two Circuit

Secure LPS to wall by screwing into wall studs or use anchors provided. If running two circuits, one for receptacles, one for lighting, connect proper wires to appropriate Romex wires. **Black** to **Black**. **White** to **White**. Ground all **Green** wires to PEM studs inside of back frame. When connecting two LPS, run Romex from fixture to fixture. Ground each section to the next.

❷ When connecting two LPS, run Romex from fixture to fixture. Ground each section to the next.

❸ To terminate last LPS, use wire nuts on ends of wires.
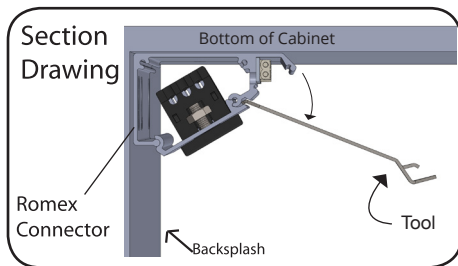
❹ Snap cover in place and turn power on.

800.445.6404 · tasklighting.com   S-LPS-SERIES-INSTALL-0517
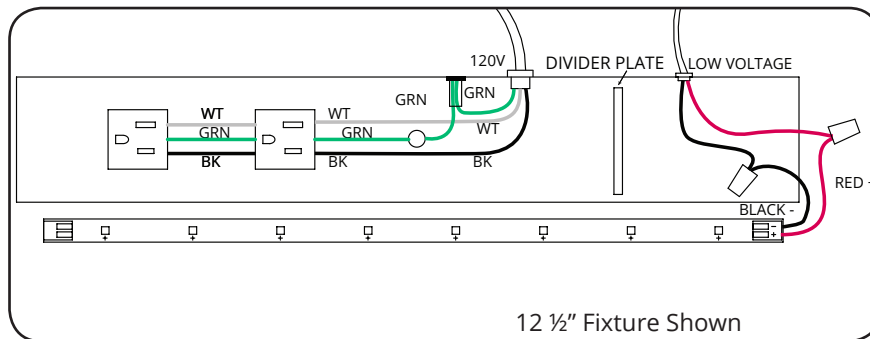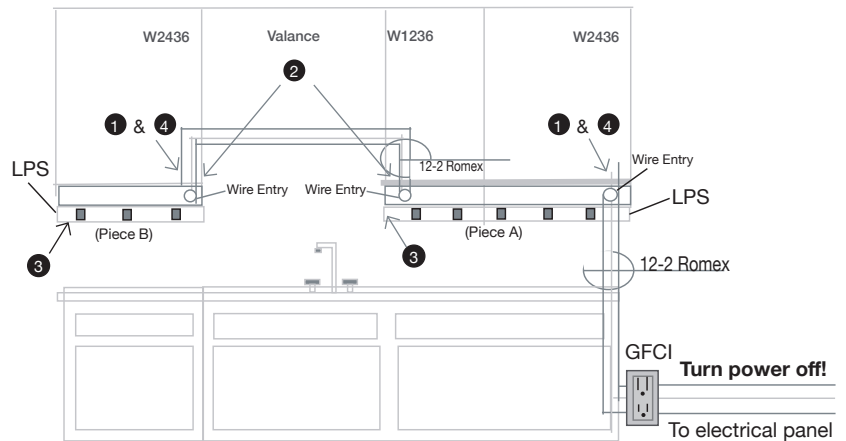
Sempria® LED Lighted Power Strip
Installation Instructions **WITHOUT** Integral Driver

General Guidelines

• Power source MUST be a 20 amp branch circuit protected by a GFCI at the panel or GFCI prior to the connection at LPS.
• All wiring must meet NEC® and local codes. The Lighted Power Strip (LPS) must be installed by a licensed electrician.
• Use knockout holes for 120V wire entrance. Use listed Romex connectors provided for 120V electrical connections.
• Use tool provided to **carefully** pry open for wiring (using other devices may damage the metal cover).
• Field cutting voids warranty.
• Light valance recommended.
• Firmly insert plug straight into receptacle, applying equal pressure to both blades at the same time. **Gently** rock plug, if needed.

Section Drawing
Bottom of Cabinet
Romex Connector
Tool
Backsplash

Turn power off at panel. **Carefully** pry open each piece with tool (provided). Insert Romex connector into knockout hole inside of back frame. Pull wires into LPS.

W2436   Valance   W1236   W2436
LPS
(Piece B)
Wire Entry   Wire Entry
12-2 Romex
Wire Entry
LPS
(Piece A)
12-2 Romex
GFCI   **Turn power off!**
To electrical panel

120V   DIVIDER PLATE   LOW VOLTAGE
WT   WT   GRN   GRN
GRN   GRN   WT
BK   BK   BK
RED +
BLACK -

12 ½" Fixture Shown

❶ **Remote Driver- 120V Entry**

Secure LPS to wall by screwing into wall studs or use anchors provided. Connect **Black** to **Black**, **White** to **White**. Ground all **Green** wires to PEM studs inside of back frame.

❷ When connecting two LPS, run Romex from fixture to fixture. Ground each section to the next.

❸ To terminate last LPS, use wire nuts on ends of wires.

❹ **Remote Driver-Low Voltage Entry**

Using appropriate knockout hole, pull low voltage wire from remote power supply into the low voltage space, connect **Black** wire (negative) to **Black** wire from lights and **Red** wire (positive) to **Red** wire.

❺ Snap cover in place and turn power on.

Positive

Negative

Back Frame

Cover

Lighting Circuit

2 - 120V Circuits
**(1 - Receptacle &
1- Lighting)**

120V Circuit

Positive

Negative

Back Frame

Cover

1 - 120V Circuit

120V Circuit

Positive

Negative

Back Frame

15vDC wire

Cover

Remote Driver

120V Circuit

800.445.6404 · tasklighting.com

S-LPS-SERIES-INSTALL-0517